


Audio	Quick Service Manual	Ref.No. : MESA0303PM17a
	Model : SA-PM17,PM27,PM47	Date : 31.March. 2004(Revised)
		Cases reported (country)
		Japan
Special customer inquiry <input type="checkbox"/>	Parts shortage solution <input type="checkbox"/>	Fregunce level
Improve by External factor <input type="checkbox"/>	Product improvement <input checked="" type="checkbox"/>	High <u>Low</u> A few One


Subject : CD Tray does not open/Close (CR16 Mechanism)

Symptom : Tray does not open/Close, Tray stuck


Cause : 1) Misalignment of mechanism.
2) Shift UD SPEED DOWN GEAR by abnormal use.
when Tray was jammed with Mechanism chassis Ribs
3) No complete initialization at power off mode.

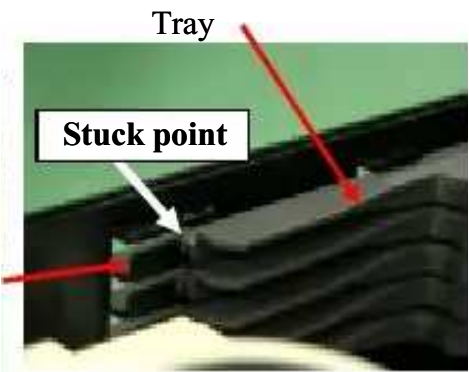

Remedy : 1) **Add** Screw to secure Gear in place. (Part No: XTBS26+8J)

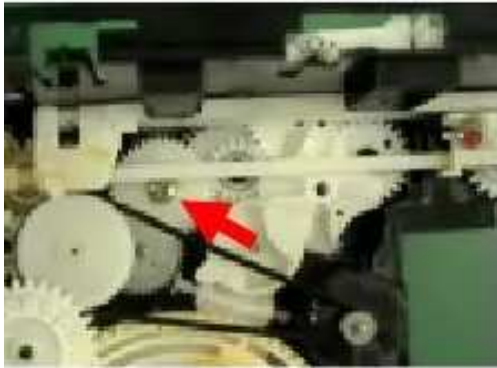


do not overtighen SCREW.

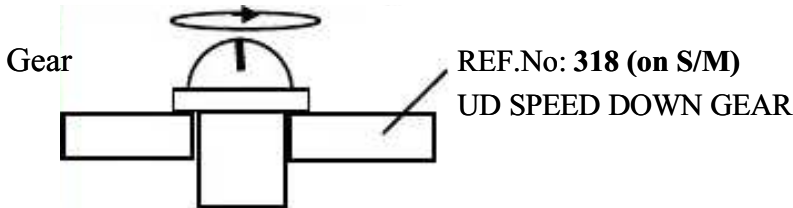


2) **Replace Select Drive Gear**(RDG0537)

3) **Cut the Ribs** on the right side of the Mecahanism Base

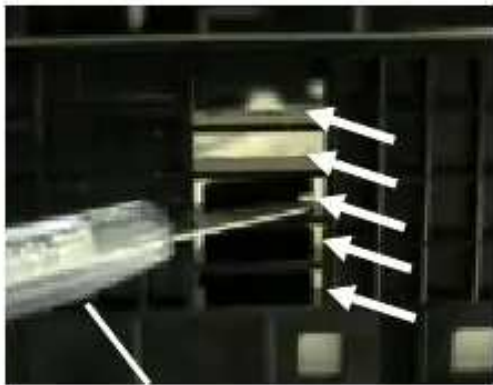

Cut all RIBS

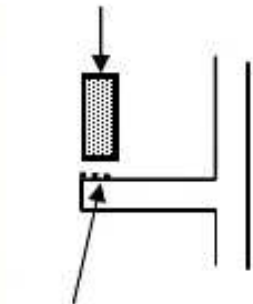

File down surface to prevent mechanical noise.

4) Complete Alignment

Utility knife

Note) Do not pull out the AC cord until the "GOOD BYE" message disappears.

Action on production :

1) From end of Nov. 2002mechanism production onwards.

Suffix was changed to "C"

440* - C

Indication is on Machanism base



2)Rib cut is not adopted to MP, because this model was discontinued.

